

USER'S MANUAL

MIG/MAG IGBT Inverter Technology
Synergic Control
Welding Power Source

MIG 320 SYNERGIC LCD

MIG 360 SYNERGIC LCD

Introduction

First of all, thank you for choosing an IWELD welding or cutting machine!

Our mission is to support your work with the most up-to-date and reliable tools both for DIY and industrial application.

We develop and manufacture our tools and machines in this spirit.

All of our welding and cutting machines are based on advanced inverter technology, reducing the weight and dimensions of the main transformer.

Compared to traditional transformer welding machines the efficiency is increased by more than 30%.

As a result of the technology used and the use of quality parts, our welding and cutting machines are characterized by stable operation, impressive performance, energy efficient and environmentally friendly operation.

By activating the microprocessor control and welding support functions, it continuously helps maintain the optimum character of welding or cutting.

Read and use the manual instructions before using the machine please!

The user's manual describes the possible sources of danger during welding, includes technical parameters, functions, and provides support for handling and adjustment but keep in mind it doesn't contain the welding knowledge!

If the user's manual doesn't provide you with sufficient information, contact your distributor for more information!

In the event of any defect or other warranty event, please observe the „General Warranty Terms”.

The user manual and related documents are also available on our website at the product data sheet.

IWELD Kft.
2314 Halásztelek
II. Rákóczi Ferenc street 90/B
Tel: +36 24 532 625
info@iweld.hu
www.iweld.hu

WARNING!

Welding is a dangerous process! The operator and other persons in the working area must follow the safety instructions and are obliged to wear proper Personal Protection Items. Always follow the local safety regulations! Please read and understand this instruction manual carefully before the installation and operation!

- The switching of the machine under operation can damage the equipment.
- After welding always disconnect the electrode holder cable from the equipment.
- Always connect the machine to a protected and safe electric network!
- Welding tools and cables used with must be perfect.
- Operator must be qualified!

ELECTRIC SHOCK: may be fatal

- Connect the earth cable according to standard regulation.
- Avoid bare hand contact with all live components of the welding circuit, electrodes and wires. It is necessary for the operator to wear dry welding gloves while he performs the welding tasks.
- The operator should keep the working piece insulated from himself/herself.

Smoke and gas generated while welding or cutting can be harmful to health.

- Avoid breathing the welding smoke and gases!
- Always keep the working area good ventilated!

Arc light-emission is harmful to eyes and skin.

- Wear proper welding helmet, anti-radiation glass and work clothes while the welding operation is performed!
- Measures also should be taken to protect others in the working area.

FIRE HAZARD



- The welding spatter may cause fire, thus remove flammable materials from the working area.
- Have a fire extinguisher nearby in your reach!

Noise can be harmful for your hearing

- Surface noise generated by welding can be disturbing and harmful. Protect your ears if needed!

Malfunctions

- Check this manual first for FAQs.
- Contact your local dealer or supplier for further advice.

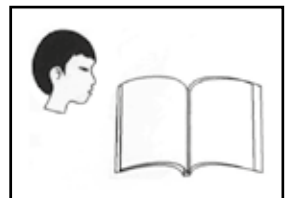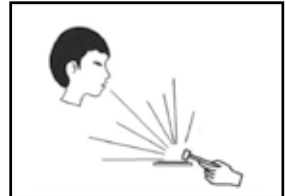


1. The main parameter

		MIG 320 SYNERGIC LCD	MIG 360 SYNERGIC LCD
Art. Nr.		800MIG320LCD	800MIG360LCD
FUNCTIONS	GENERAL	Inverter type	IGBT
		Water Cooling System	✗
		Digital Control	OLED
		Number of Programs	20
		EMC	✓
	MIG	Synergic Control	✓
		Pulse	✗
		Double Pulse	✗
		Cool Pulse	✗
		Reverse Polarity - FCAW	✓
		2T/4T	✓
		S2T	✓
		SPOT	✓
		Portable Wire Feeder Unit	✗
		Compact Design	✓
Number of Wire Feeder Rolls	4		
PARAMETERS	Accessories MIG Torch	IGrip 360	IGrip 360
	Optional MIG Torch	-	-
	Phase number	3	3
	Rated input Voltage	400V AC ±10%, 50/60 Hz	400V AC ±10%, 50/60 Hz
	Max./eff. input Current	17A / 12A	22A / 17A
	Power Factor (cos φ)	0.9	0.9
	Efficiency	80 %	80 %
	Duty Cycle (10 min/40 °C)	300A/29V @ 60% 271A/25.6V @ 100%	350A/31.5V @ 60% 271A/27.6V @ 100%
	Welding Current Range	60A-300A	50A-350A
	Output Voltage	15V-29V	16.5V-31.5V
	No-Load Voltage	55V	64V
	Insulation	H	H
	Protection Class	IP21S	IP21S
	Welding Wire Diameter	Ø 0.8 - 1.6 mm	Ø 0.8 - 1.6 mm
	Size of Coil	Ø 270 mm, 15kg	Ø 270 mm, 15kg
Weight	42 kg	42 kg	
Dimensions (LxWxH)	875x420x807mm	875x420x807mm	

2. Installation

2-1. Input wire connection

1. Each machine is equipped with primary power wire, according to the input voltage, please connect the primary wire to the suitable voltage class.
2. The primary wire should be connected to the corresponding socket to avoid oxidation.
3. Use multi-meter to see whether the voltage value varies in the given range.

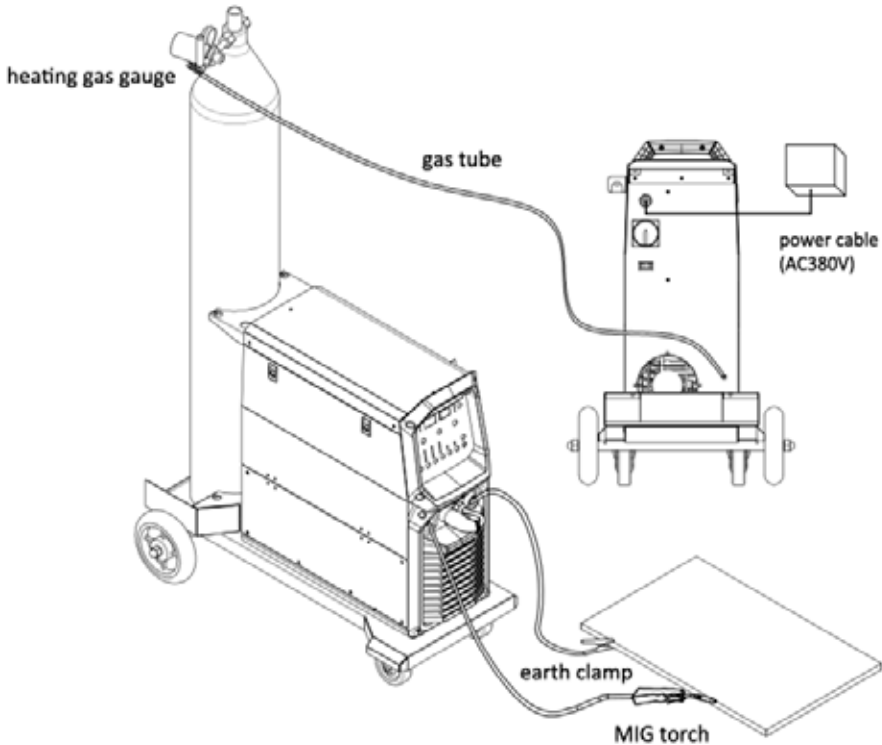

2-2. Connection of output wires

1. Connect the terminal of the earth clamp with the negative output, another side is clamped on the workpiece
2. Connect the MIG torch with the output terminal on the wire feeding machine, insert the welding wire through the MIG torch manually.
3. Connect the control cable socket to the wire feeder by control cable.
4. Connect the wire feeding machine input cable with the positive terminal of power source. The control cable of wire feeding machine should be connected with the control connector of power source.

2-3. Welding wire reel installation

1. Install the wire reel on the holder of wire feeding machine, the hole of wire reel should align with fixed pin on the holder
2. Choose different wire feeding groove according to the wire dimension.
Note: aluminum welding choose U-shape groove, other welding wire choose the V-shape groove.
3. Loose the nut of wire pressing roller, thread the welding wire from the spool through the input guide tube, through the roller groove and into the outlet guide tube. Note: adjust the wire pressing roller and impact the wire, to make sure the wire will not slide. Avoid the wire deformation due to the oversize pressure
4. Release the wire by rotating the wire reel anticlockwise. In order to avoid wire loose, the new wire reel will fix the top of wire on the edge of wire reel. Please cut off this top of wire.
5. Choose different wire feeding groove position according to the wire diameter.
6. Press "wire check" button to lead out the wire.

2-4. Connection of Shielding Gas Bottle

Connect the CO₂ hose, which come from the wire feeder to the copper nozzle of gas bottle. The gas supply system includes the gas bottle, the air regulator and the gas hose.

The heater cable should be plug into the socket of machine's back side, and use the hose clamp to tighten it to prevent leaking or air-in, so that the welding spot is protected.

Please note:

1. Leakage of shielding gas affects the performance of arc welding.
2. Avoid the sun shine on the gas cylinder to eliminate the possible explosion of gas cylinder due to the increasing pressure of gas resulted from the heat.
3. It is extremely forbidden to knock at gas cylinder and lay the cylinder horizontally.
4. Ensure no person is up against the regulator, before the gas release or shut the gas output.
5. The gas output volume meter should be installed vertically to ensure the precisely measuring.
6. Before the installation of gas regulator, release and shut the gas for several time in order to remove the possible dust on the sieve to avail the gas output.

Note: Since the arc of MIG welding is much strong than that of MMA welding, please wear welding helmet and protective clothing.

3. Operation

3-1. Control Panel



A	Wire Check
B	Gas Check
C	Mode and Voltage adjustment
D	Mode selection interface, Enter button
E	Function button
F	Function adjustment knob: - Current adjustment - Inductance adjustment - Wire diameter adjustment - 2T/4T adjustment - Post-flow adjustment - Slow wire-feeding adjustment - Hot start adjustment - ARC force adjustment - VRD adjustment



MODE SELECTION INTERFACE


Rotate the knob to select the mode, then press the knob to confirm.

3-1 Parameter adjustment in MIG/MAG welding mode.




- Inductance
- Wire diameter
- 2T/4T
- Post-flow time
- Slow wire-feeding
- Welding current
- Welding voltage

3-2 Parameter adjustment in MMA welding mode.

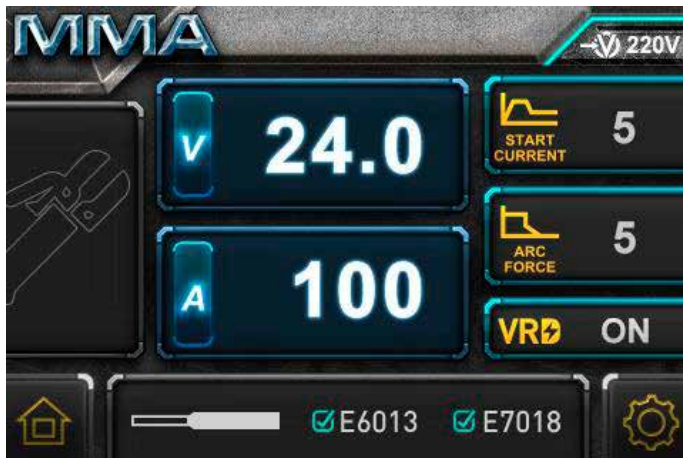

- Welding current
- Hot start
- ARC force
- VRD

3-2 Parameter adjustment in TIG welding mode.

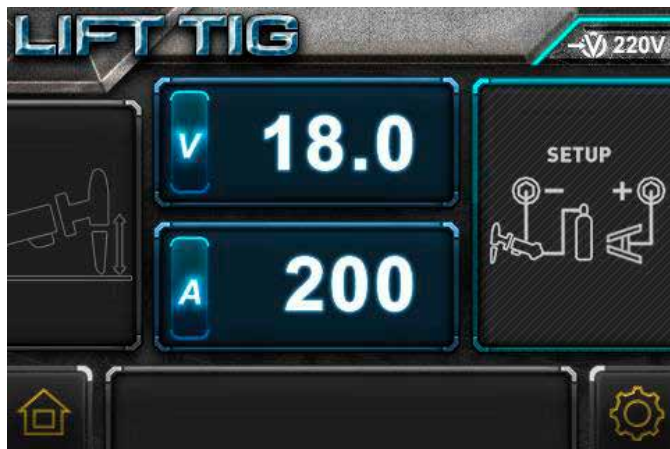

- Welding current adjustment



- Alerts: OVER TEMPERATURE!

4. Operation instructions

1. Turn the machine ON using the main switch. Open the valve of the gas bottle and adjust the gas flow
2. Select the diameter of MIG torch nozzle according to the welding wire diameter. Select the parameters the welding mode ("H") and the cooling mode ("I"). - If you choose MMA welding mode(with or without VRD function) adjust the MMA welding parameters ("F").
 - If you choose TIG welding mode, adjust the welding parameters.
 - If you choose MIG/MAG welding mode, adjust the welding parameters on the control panel of wire feeder.
3. According to thickness and process of workpiece, adjust the voltage and the current. Select the "synergy" or "manual" function by pressing the "K" button on the control panel of wire feeder.
4. Inductance adjustment can change the ARC strenght.
5. Begin to weld by pressing.

4.1 Setting the welding current

The selection of welding current ,voltage and ARC will influence the stability, welding quality and the productivity during the welding process. In order to keep a good welding quality, the welding current should match the voltage and the ARC well. Select the wire diameter according to the globular transfer and the production requirement. Refer to the below list, choose the common welding current, ARC and voltage.

-The option of the welding speed

The welding quality and productivity should be taken into consideration for the option of welding speed. In case that the welding speed increases, it weakens the protection efficiency and speeds up the cooling process. As a consequence, it is not optimal for the seaming. In the event that the speed is too slow, the work piece will be easily damaged, and the seaming is not ideal. In practical operation, the welding speed should not exceed 30m/hour.

-The length of wire stretching out

The length of wire stretching out the nozzle should be appropriate. The increase of the length of wire stretching out of the nozzle can improve the productivity, but if it is too long, excessive spatter will occur in the welding process. Generally, the length of wire stretching out the nozzle should be 10 times as the welding wire diameter.

-The setting of the CO₂ flow volume

The protection efficiency is the primary consideration. Besides, inner-angle welding has better protection efficiency than external-angel welding. For the main parameter, refer to the following figure.

Welding mode	Thin wire CO ₂ welding	Thick wire CO ₂ welding	Thick wire, big current CO ₂ welding
CO ₂ (l/min)	5-15	15-25	25-50

5. Welding parameters table

The option of the welding current and welding voltage directly influences the welding stability, welding quality and productivity. In order to obtain the good welding quality, the welding current and welding voltage should be set optimally. Generally, the setting of weld condition should be according to the welding diameter and the melting form as well as the production requirement.

The following parameter is available for reference.

5.1. Parameter for butt-welding (Please refer to the following figure.)

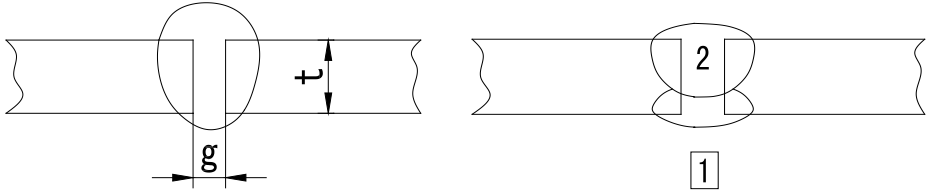


Plate thickness t (mm)	Gap g (mm)	Wire \varnothing (mm)	Welding current (A)	Welding voltage (V)	Welding speed (cm/min)	Gas volume (l/min)
0.8	0	0.8~0.9	60~70	16~16.5	50~60	10
1.0	0	0.8~0.9	75~85	17~17.5	50~60	10~15
1.2	0	1.0	70~80	17~18	45~55	10
1.6	0	1.0	80~100	18~19	45~55	10~15
2.0	0~0.5	1.0	100~110	19~20	40~55	10~15
2.3	0.5~1.0	1.0 or 1.2	110~130	19~20	50~55	10~15
3.2	1.0~1.2	1.0 or 1.2	130~150	19~21	40~50	10~15
4.5	1.2~1.5	1.2	150~170	21~23	40~50	10~15

5.2. Parameter for flat fillet welding (Please refer to the following figure.)

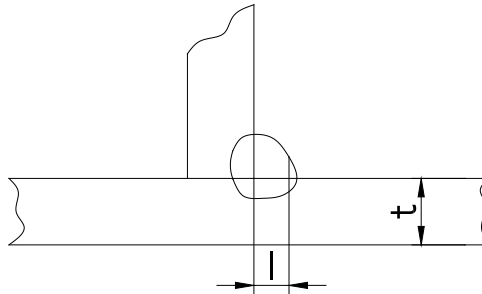


Plate thickness t (mm)	Gap g (mm)	Wire \varnothing (mm)	Welding current (A)	Welding voltage (V)	Welding speed (cm/min)	Gas volume (l/min)
1.0	2.5~3.0	0.8~0.9	70~80	17~18	50~60	10~15
1.2	2.5~3.0	1.0	70~100	18~19	50~60	10~15
1.6	2.5~3.0	1.0 ~ 1.2	90~120	18~20	50~60	10~15
2.0	3.0~3.5	1.0 ~ 1.2	100~130	19~20	50~60	10~20
2.3	2.5~3.0	1.0 ~ 1.2	120~140	19~21	50~60	10~20
3.2	3.0~4.0	1.0 ~ 1.2	130~170	19~21	45~55	10~20
4.5	4.0~4.5	1.2	190~230	22~24	45~55	10~20

5.3 Parameter for fillet welding in the vertical position (Please refer to the following figure.)


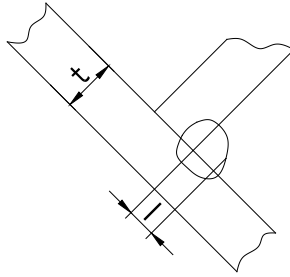


Plate thickness t (mm)	Gap g (mm)	Wire Ø (mm)	Welding current (A)	Welding voltage (V)	Welding speed (cm/min)	Gas volume (l/min)
1.6	2.5~3.0	1.0 ~ 1.2	90~120	18~20	50~60	10~15
2.0	3.0~3.5	1.0 ~ 1.2	100~130	19~20	50~60	10~20
2.3	3.0~3.5	1.0 ~ 1.2	120~140	19~21	50~60	10~20
3.2	3.0~4.0	1.0 ~ 1.2	130~170	22~22	45~55	10~20
4.5	4.0~4.5	1.2	200~250	23~26	45~55	10~20
3.2	1.0~1.2	1.0 or 1.2	130~150	19~21	40~50	10~15
4.5	1.2~1.5	1.2	150~170	21~23	40~50	10~15

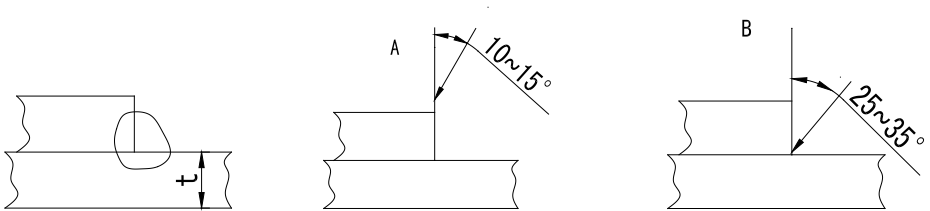

5.4 Parameter for Lap Welding (Please refer to the following figure.)

Plate thickness t (mm)	Gap g (mm)	Wire Ø (mm)	Welding current (A)	Welding voltage (V)	Welding speed (cm/min)	Gas volume (l/min)
1.2	A	1.0	80~100	18~19	45~55	10~15
1.6	A	1.0 ~ 1.2	100~120	18~20	45~55	10~15
2.0	A or B	1.0 ~ 1.2	100~130	18~20	45~55	15~20
2.3	B	1.0 ~ 1.2	120~140	19~21	45~50	15~20
3.2	B	1.0 ~ 1.2	130~160	19~22	45~50	15~20
4.5	B	1.2	150~200	21~24	40~45	15~20
4.5	1.2~1.5	1.2	150~170	21~23	40~50	10~15

Precautions

Workspace

1. Welding equipment free of dust, corrosive gas, non-flammable materials, up to 90% humidity for use!
2. Avoid welding outdoors unless protected from direct sunlight, rain, snow, work area temperature must be between -10 °C and +40°C.
3. Wall to position the device at least 30 inches away.
4. Well-ventilated area to perform welding.

Safety requirements

Welding provides protection against overvoltage / overcurrent / overheating. If any of the above events occurs, the machine stops automatically. However, over-stress damage to the machine, keep the following guidelines:

1. Ventilation. When welding a strong current going through the machine, so the machine is not enough natural ventilation for cooling. The need to ensure adequate cooling, so the distance between the plane and any object around it at least 30 cm. Good ventilation is important to normal function and service life of the machine.
2. Continuously, the welding current does not exceed the maximum allowable value. Current overload may shorten its life or damage to the machine.
3. Surge banned! Observance of tension range follow the main parameter table. Welding machine automatically compensates for voltage, allowing the voltage within permissible limits of law. If input voltages exceed the specified value, damaged parts of the machine.
4. The machine must be grounded! If you are operating in a standard, grounded AC pipeline in the event of grounding is provided automatically. If you have a generator or foreign, unfamiliar, non-grounded power supply using the machine, the machine is required for grounding connection point earth to protect against electric shock.
5. Suddenly stopping may be during welding when an overload occurs or the machine overheats. In this case, do not restart the computer, do not try to work with it right away, but do not turn off the power switch, so you can leave in accordance with the built-in fan to cool the welding machines.

WARNING!

If the welding equipment is used with the welding parameters above 180 amperes, the standard 230V electrical socket and plug for 16 amp circuit breaker is not sufficient for the required current consumption, it is necessary to use the welding equipment with 20A, 25A or even to the 32A industrial fuses! In this case, both the plug and the plug socket fork have to be replaced to 32A single phase fuse socket in compliance with all applicable rules. This work may only be carried out by specialists!

Maintenance

1. Remove power unit before maintenance or repair!
2. Ensure that proper grounding!
3. Make sure that the internal gas and electricity connections are perfect and tighten, adjust if necessary, if there is oxidation, remove it with sandpaper and then reconnect the cable.
4. Hands, hair, loose clothing should be kept away under electric parts, such as wires, fan.
5. Regularly dust from the machine clean, dry compressed air, a lot of smoke and polluted air to clean the machine every day!
6. The gas pressure is correct not to damage components of the machine.
7. If water would be, for example. rain, dry it in the machine and check the insulation properly! Only if everything is all right, go after the welding!
- 8 When not in use for a long time, in the original packaging in a dry place.

CERTIFICATE OF EUROPEAN STANDARD

Manufacturer:	IWELD Ltd. 2314 Halásztelek II. Rákóczi Ferenc street 90/B Tel: +36 24 532-625 info@iweld.hu www.iweld.hu
Item:	MIG 320 SYNERGIC LCD MIG 360 SYNERGIC LCD MIG/MAG IGBT Inverter Technology Synergic Control Welding Power Source
Applied Rules (1):	EN 60204-1:2005 EN 60974-10:2014, EN 60974-1:2018

(1) References to laws, rules and regulations are to be understood as related to laws, rules and regulations in force at present.


Manufacturer declares that the above specified product is complying with all of the above specified rules and it also complying with the essential requirements as specified by the Directives 2014/35/EU, 2014/30/EU, 2006/42/EU and 2011/65/EU

Serial No.:



Halásztelek (Hungary),

14/03/20

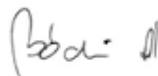

Managing Director:
András Bódi

ÁLTALÁNOS GARANCIÁLIS FELTÉTELEK A JÓTÁLLÁSI ÉS SZAVATOSÁGI IGÉNYEK ESETÉN

1. 12 hónap kötelező jótállás

A jótállás időtartama 12 hónap. A jótállási határidő a fogyasztási cikk fogyasztó részére történő átadása, vagy ha az üzembe helyezést a vállalkozás vagy annak megbízottja végzi, az üzembe helyezés napjával kezdődik.

Nem tartozik jótállás alá a hiba, ha annak oka a termék fogyasztó részére való átadását követően lépett fel, így például, ha a hibát

- szakszerűtlen üzembe helyezés (kivéve, ha az üzembe helyezést a vállalkozás, vagy annak megbízottja végezte el, illetve ha a szakszerűtlen üzembe helyezés a használati-kezelési útmutató hibájára vezethető vissza)
- rendeltetés-ellenes használat, a használati-kezelési útmutatóban foglaltak figyelmen kívül hagyása,
- helytelen tárolás, helytelen kezelés, rongálás,
- elemi kár, természeti csapás okozta.

Jótállás keretében tartozó hiba esetén a fogyasztó - elsősorban - választása szerint - kijavítást vagy kicserélést követelhet, kivéve, ha a választott jótállási igény teljesítése lehetetlen, vagy ha az a vállalkozásnak a másik jótállási igény teljesítésével összehasonlítva aránytalan többletköltséget eredményezne, figyelembe véve a szolgáltatás hibátlan állapotban képviselt értékét, a szerződésszegés súlyát és a jótállási igény teljesítésével a fogyasztónak okozott érdeksérelmet.

- ha a vállalkozás a kijavítást vagy a kicserélést nem vállalta, e kötelezettségének megfelelő határidőn belül, a fogyasztó érdekeit kímélve nem tud eleget tenni, vagy ha a fogyasztónak a kijavításhoz vagy a kicseréléshez fűződő érdeke megszűnt, a fogyasztó elállhat a szerződéstől. Jelentéktelen hiba miatt elállásnak nincs helye.

A fogyasztó a választott jogáról másra térhet át. Az áttéréssel okozott költséget köteles a vállalkozásnak megfizetni, kivéve, ha az áttérésre a vállalkozás adott okot, vagy az áttérés egyébként indokolt volt.

A kijavítást vagy kicserélést – a termék tulajdonságaira és a fogyasztó által elvárható rendeltetésére figyelemmel – megfelelő határidőn belül, a fogyasztó érdekeit kímélve kell elvégezni. A vállalkozásnak törekednie kell arra, hogy a kijavítást vagy kicserélést legfeljebb tizenöt napon belül elvégezze.

A kijavítás során a termékbe csak új alkatrészt kerülhet beépítésre.

Nem számít bele a jótállási időbe a kijavítási időnek az a része, amely alatt a fogyasztó a terméket nem tudja rendeltetészerűen használni. A jótállási idő a terméknek vagy a termék részének kicserélése (kijavítása) esetén a kicserélt (kijavított) termék (termékrészre), valamint a kijavítás következményeként jelentkező hiba tekintetében újból kezdődik.

A jótállási kötelezettség teljesítésével kapcsolatos költségek a vállalkozást terhelik.

A jótállás nem érinti a fogyasztó jogszabályból eredő – így különösen kellek- és termékszavatossági, illetve kártérítési – jogainak érvényesítését.

Fogyasztói jogvita esetén a fogyasztó a megyei (fővárosi) kereskedelmi és iparkamarák mellett működő békéltető testület eljárását is kezdeményezheti. A jótállási igény a jótállási jeggyel érvényesíthető. Jótállási jegy fogyasztó rendelkezésére bocsátásának elmaradása esetén a szerződés megkötését bizonyítottan kell tekinteni, ha az ellenérték megfizetését igazoló bizonylatot - az általános forgalmi adóról szóló törvény alapján kibocsátott számlát vagy nyugtát - a fogyasztó bemutatja. Ebben az esetben a jótállásból eredő jogok az ellenérték megfizetését igazoló bizonylattal érvényesíthetők.

A fogyasztó jótállási igényét a vállalkozásnál érvényesítheti.

2. Kiterjesztett garancia

Az IWELD Kft. a Forgalmazókkal együttműködve, az 1 éves kellekszavatossági kötelezettségét +1 évvel kiterjeszti (2 évre) a következőben felsorolt hegesztőgépekre az alábbi feltételekkel:

minden GORILLA® hegesztőgép, ARC 160 MINI, HEAVY DUTY 250 IGBT, HEAVY DUTY 315 IGBT

A garanciavállalás során a Polgári Törvénykönyv 6:159. § (hibás teljesítési vélelem) nem alkalmazható, és a kiterjesztett garanciavállalás a Polgári Törvénykönyv 6:159. § - 6:167. § meghatározott kellekszavatossági jellegű felelősségvállalást jelent az alábbi feltételekkel.

A kiterjesztett garancia feltételei fent felsorolt hegesztőgépek esetében:

- Származás igazolása (eredeti számla, tulajdonos változás esetén adás-vételi szerződés) A végfelhasználónak meg kell őrizni a kiterjesztett garancia ideje alatt végig a vásárlást igazoló számlát!
- Kitöltött garancia jegy
- Maximum 12 havonta szakszerviz által elvégzett karbantartás, ami az átvizsgáláson és érintésvédelmi ellenőrzésen túl a teljes burkolat eltávolítása utáni szakszerű takarításból kell, hogy álljon!
- Karbantartást igazoló számlák és karbantartási jegyzőkönyv
A számláknak és egyéb dokumentumoknak mindenképpen tartalmaznia kell a berendezés típusát (típuszám, modell) és szériaszámát (Serial no.)!

A kiterjesztett garancia tartalma:

A kiterjesztett garanciát alkatrész, tényleges javítás, vagy csere formájában biztosítjuk. Amennyiben a javítás nem lehetséges, úgy a hibás eszköz cseréjét biztosítjuk.

A kiterjesztett garancia sem tartalmazza a berendezés postázását, országon belüli szállítását! A termék forgalmazója, szükség esetén, (kötelezettség nélküli) segítséget nyújt a berendezés szakszervizbe való eljuttatásában!

A kiterjesztett garanciális javításokat saját szakszervizünkben a cég telephelyén végezzük:

IWELD Kft. 2314 Halásztelek II. Rákóczi Ferenc út 90/B

Tel.: +36 24 532 625

szerviz@iweld.hu

H

JÓTÁLLÁSI JEGY

Forgalmazó:

IWELD KFT.
2314 Halásztelek
II. Rákóczi Ferenc út 90/B
Szerviz: Tel: +36 24 532 706
mobil: +36 70 335 5300

Sorszám:

..... típusú..... gyári számú
termékre a vásárlástól számított 12 hónapig kötelező jótállást vállalunk a jogszabály szerint. A jótállás lejártá után 3 évig biztosítjuk az alkatrész utánpótlást.

Vásárláskor kérje a termék próbáját!

Eladó tölti ki:

A vásárló neve:

Lakhelye:

Vásárlás napja: ÉV HÓ NAP

Eladó bélyegzője és aláírása:

Jótállási szelvények a kötelező jótállási időre

Bejelentés időpontja:

Hiba megszüntetésének időpontja:

Bejelentett hiba:

A jótállás új határideje:

A szerviz neve: Munkaszám:

..... ÉV HÓ NAP

.....

aláírás

Figyelem!

A garancia jegyet vásárláskor érvényesíteni kell a készülék gyári számának feltüntetésével! A garancia kizárólag azonos napon, kiállított gyári számmal ellátott számlával együtt érvényes, ezért a számlát őrizze meg!

RO

Certificat de garanție

Distribuitor:

IWELD KFT.

2314 Halásztelek

Str. II.Rákóczi Ferenc 90/B

Ungaria

Service: Tel: +36 24 532 706

mobil: +36 70 335 5300

Număr:

..... tipul.....număr de serie
necesare sunt garantate timp de 12 luni de la data de produse de cumpărare, în conformitate cu legea. La trei ani după
expirarea garanției oferim piese de aprovizionare.

La cumpărături încercați produsul!

Completat de către Vanzător:

Numele clientului:

Adresa:

Data de cumpărare: An..... Lună Zi

Ștampila și semnătura vânzătorului:

Secțiuni de garanție a perioadei de garanție

Data raportului:

Data încetării:

Descriere defect:

Noul termen de garanție:.....

Numele serviciului: Cod de locuri de muncă:.....

..... An..... Lună Zi

.....
semnătura

Data raportului:

Data încetării:

Descriere defect:

Noul termen de garanție:.....

Numele serviciului: Cod de locuri de muncă:.....

..... An..... Lună Zi

.....
semnătura

Atenție!

Garanția trebuie să fie validată la timp de cumpărare a biletului fabrica numărul! Garanție numai pe aceeași zi, cu o factură poartă numărul de eliberat este valabil pentru o fabrica, deci proiectul de lege să-l păstrați!

SK

ZÁRUČNÝ LIST

Distribútor:

IWELD KFT.
2314 Halásztelek
II. Rákóczi Ferenc út 90/B
Service: Tel: +36 24 532 706
mobil: +36 70 335 5300

Poradové číslo:

Výrobok: Typ: Výrobné číslo:

Na tento výrobok platí záruka 12 mesiacov od kúpy podľa platnej legislatívy. Na uplatnenie záruky je nutné predložiť originálny nákupný doklad! Po uplynutí záručnej doby 3 roky Vám zabezpečíme prísun náhradných dielov.

Pri kúpe tovaru požiadajte o rozbalenie a kontrolu výrobku!

Vyplní predajca:

Meno kupujúceho:

Bydlisko:

Dátum zakúpenia: deň: mesiac: rok:

Pečiatka a podpis predajcu:

ZÁRUČNÉ KUPÓNY

Dátum nahlásenia:

Dátum odstránenia vady:

Nahlásená vada:

Nová záručná doba:

Návoz servisu: Číslo práce:

Deň: mesiac: rok:

.....
Podpis

Dátum nahlásenia:

Dátum odstránenia vady:

Nahlásená vada:

Nová záručná doba:

Návoz servisu: Číslo práce:

Deň: mesiac: rok:

.....
Podpis

CZ

ZÁRUČNÍ LIST

Distributor:

IWELD KFT.
2314 Halásztelek
II. Rákóczi Ferenc út 90/B
Tel: +36 24 532-625
Fax: +36 24 532-626

Pořadové číslo:

Výrobek: Typ: Výrobní číslo:

Na tento výrobek platí záruka 12 měsíců od koupě dle platné legislativy. Na uplatnění záruky je nutné předložit originální nákupní doklad! Po uplynutí záruční doby 3 roky Vám zajistíme přísun náhradních dílů.

Při koupi zboží požádejte o rozbalení a kontrolu výrobku!

Vyplní prodejce:

Jméno kupujícího:

Bydliště:

Datum zakoupení: den: měsíc: rok:

Razítko a podpis prodejce:

ZÁRUKA

Datum nahlášení:

Datum odstranění vady:

Nahlášená vada:

Nová záruční doba:

Návoz servisu: Číslo práce:

Den: měsíc: rok:

.....
Podpis

Datum nahlášení:

Datum odstranění vady:

Nahlášená vada:

Nová záruční doba:

Návoz servisu: Číslo práce:

Den: měsíc: rok:

.....
Podpis

